
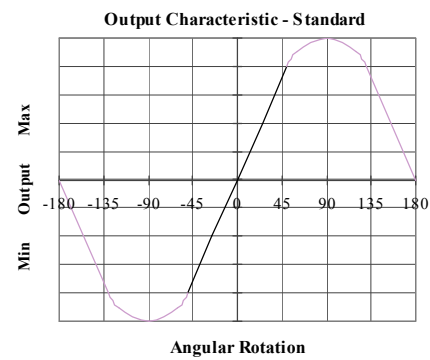


Installation Information


RIPS[®] P501 MINIATURE ROTARY SENSOR

Electronics Option	Output Description:	Supply Voltage: (Vs)	Output:	Load resistance: (include leads for 4 to 20mA O/Ps)	Load connected to:
A	Voltage (ratiometric with supply)	5±0.5V	0.5 to 4.5V	2kΩ min	0V

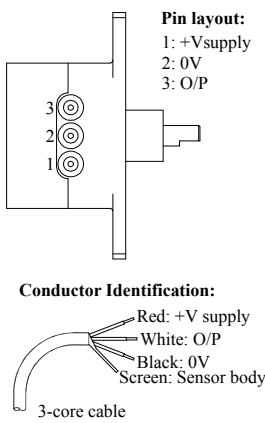

Mechanical Mounting:

Flange mounted. The flange slots are 4.5mm by 20 degrees wide, 48mm pitch. The sensor should be mounted with minimal axial and radial loading on the shaft for optimum life. It is recommended that the shaft is coupled to the drive using a flexible coupling.

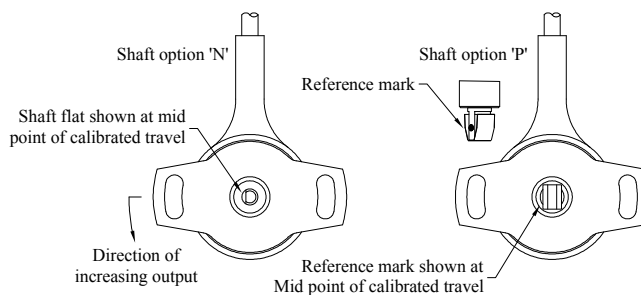

Option 'N' shaft: Ø 4 mm x 8 mm long, flat 3 mm A/F x 4 mm. Option 'P' shaft: fits 6 x 3 mm slot.

Output Characteristic:

The sensor has full rotational freedom and two sectors, 180° apart, over which linear response can be achieved. At the mid point of the calibrated range the output signal will be half full scale deflection, shaft alignment as sketch above. In the calibrated range the output increases as the shaft is rotated in an anti-clockwise direction viewed from the shaft. The calibrated output is factory set to be between 20 and 160°.

Incorrect Connection Protection levels:-

A **Not protected** – the sensor is **not** protected against either reverse polarity or over-voltage. The risk of damage should be minimal where the supply current is limited to less than 50mA.

For further information please contact:



UK / Europe Office
 Tel: +44 (0)845 9000 601
 Fax: +44 (0)845 9000 602
info@omniinstruments.co.uk
www.omniinstruments.co.uk

Australia / Asia Pacific Office
 Tel +61 (0)282 442 363
 Fax +61 (0)294 751 278
info@omniinstruments.com.au
www.omniinstruments.com.au

USA / Canada Office
 Tel +1-866-849-3441
 Fax +1-866-628-8055
info@omniinstruments.net
www.omniinstruments.net